

Work Order ID 133036

133036

Page 1

Monday, May 25, 2015 9:01:19 AM

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 5/25/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/25/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MCS Date: MAY 25 2015

Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D407-667-245	Rev G

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8531 on both ends as per Folio FA248

2-Turn first side as per Folio FA248

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: AADWG REV: 6

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

1 ϕ

mym L
15/05/27

110

QC1- Inspection performed by CMM

0.00

110

QC

Memo

0.00

Quality Control

1 ϕ

mym L
15/05/28

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																							
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :	
Misidentified ☐	Past Due ☐																																																														

Work Order ID 133036

133036

Page 2

Monday, May 25, 2015 9:01:19 AM

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 5/25/2015 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 5/25/2015 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

120

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

Memo

1-Turn second side as per Folio FA248

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: AA

DWG REV: 6

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D407-667-245

0.00

0.00

130

130

QC

Quality Control

QC1- Inspection performed by CMM

Memo

0.00

0.00

1 0
mmL
15/05/30

1 0
mmL
15/05/30

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
								QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			OTHER : ☐																	

Monday, May 25, 2015 9:01:19 AM

Page 3

2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval 	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	

Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____			
Misidentified ☐		Past Due ☐					

Work Order ID 133036

Monday, May 25, 2015 9:01:19 AM

133036

Page 4

Item ID: D407-667-205TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 5/25/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/25/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

QC5- Inspect part completeness to step on W/O

0.00

160

QC

Memo

0.00

Quality Control

 15-6-2 DAS
03
9-89

170

Packaging

0.00

170

Packaging

Memo

0.00

Packaging

Identify and stock in kanban rackLocation: LG014

 15-06-02

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.00

Quality Control

 JUN 03 2015

 JUN 03 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Monday, May 25, 2015 9:01:23 AM

Page 1

Work Order ID: 133036

133036

Parent Item: D407-667-205TRN

D407-667-205TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 5/25/2015

Required Date: 5/25/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 Removed polish EC verified by: DD
IPP Rev:C 08-08-19 revE as per dwg DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D6011-115

Manufactured

No

120

Each

36.0000

1

1

D6011-115

Crosstube Material

Location

Loc Qty

Loc Code

LG003

36

107880

22

107881

2

67798

6

75639

6

1 mm L 15/05/27

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval				
Description Work Order Deviation				Disposition				Completed By			
								Lead hand / Supervisor Approval Verification			
								QC / QA Coordinator Approval			
Root Cause		FAULT CATEGORY									
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____									
Misidentified ☐	Past Due ☐										


DART AEROSPACE LTD		Work Order:	133036
Description: Crosstube Assembly		Part Number:	D407-667-245
Inspection Dwg: D407-667-245 Rev: G		Page 1 of 2	

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.494	/		vern	CNC-08
	1.832	+0.005/-0.000	1.835	/			
	1.838	+0.005/-0.000	1.843	/			
	1.892	+0.005/-0.000	1.897	/			
	2.052	+0.005/-0.000	2.057	/			
	2.206	+0.005/-0.000	2.211	/			
	2.521	+0.005/-0.000	2.526	/			
	2.633	+0.005/-0.000	2.637	/			
	4.10	+/-0.030	4.10	/			
	4.978	+/-0.030	4.980	/			
	2.040	+0.000/-0.010	2.035	/			
	0.125	+/-0.010	.125	/			
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010	.500	/		11	
	2.490	+0.005/-0.000	2.493	/		vern	CNC-08
	1.832	+0.005/-0.000	1.831	/			
SIDE B	1.838	+0.005/-0.000	1.843	/			
	1.892	+0.005/-0.000	1.896	/			
	2.052	+0.005/-0.000	2.057	/			
	2.206	+0.005/-0.000	2.209	/			
	2.521	+0.005/-0.000	2.525	/			
	2.633	+0.005/-0.000	2.636	/			
	4.10	+/-0.030	4.100	/			
	4.978	+/-0.030	4.980	/			
	2.040	+0.000/-0.010	2.036	/			
	0.125	+/-0.010	.125	/			
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010	.500	/		11	
	112.91	+/-0.020	112.91	/		tape	10-11

DART AEROSPACE LTD		Work Order: 133036
Description: Crosstube Assembly		Part Number: D407-667-245
Inspection Dwg: D407-667-245 Rev: G		Page 2 of 2

WALL THICKNESS MEASUREMENT

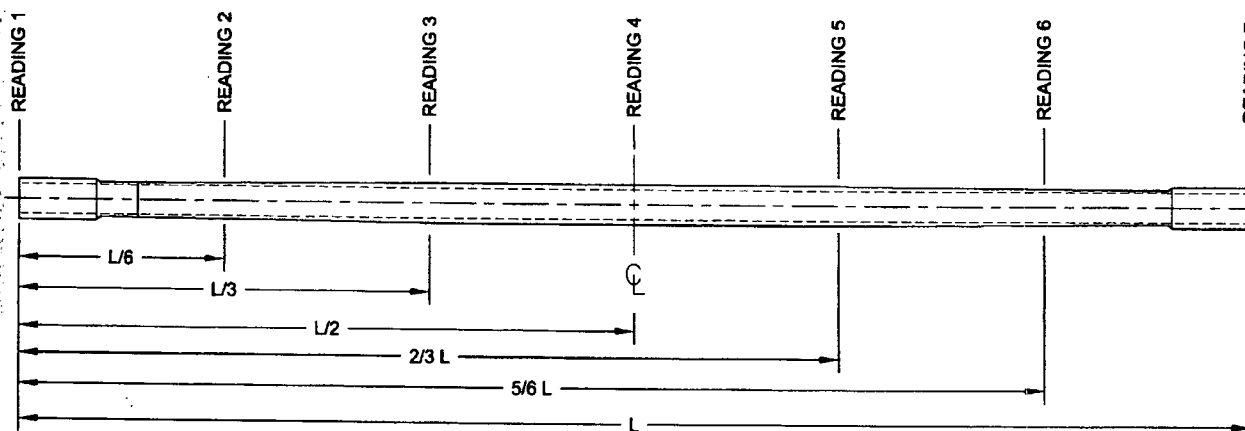

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.231	.240	.241	.227	.014	0.075"
READING 2 L= 19	.217	.272	.288	.245	.071	
READING 3 L= 37	.374	.427	.442	.399	.068	
READING 4 L= 56	.640	.651	.679	.666	.039	
READING 5 L= 75	.390	.411	.460	.444	.070	
READING 6 L= 93	.244	.251	.275	.275	.026	
READING 7 L= 112	.235	.233	.234	.239	.006	

Calibration Result

Actual Block Thickness: 100 - 750

Situscan 250 Measured Thickness: 100 - 750

DAS
47

Measured by: <i>MAL</i>	Audited by: 9-89	Preliminary Approval:
Date: 15/09/30	Date: 15-06-01	Date:

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	
F	12.06.04	Wall thickness form added	KJ	
G	15.05.14	Dwg Rev updated	KJ	<i>[Signature]</i>

Item	QTY -245	PART NUMBER	DESCRIPTION
	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
1	1	D6011-115	CROSSTUBE
2	2	D2873-043	NUT PLATE
3	2	D2873-045	NUT PLATE
4	1	D2894-1	SUPPORT
5	2	D3190-1	CHAFING SHIELD
6	2	D3595-063-430	RUBBER CUSHION
7	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
8	4	MS21920-22	CLAMP
9	2	MS21920-25	CLAMP (OR MS21920-24)
10	AR	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
11	AR	PROSEAL 890	SEALANT

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT CROSSTUBE PER DART QSI 005 4.2
FOR HATCHED AREAS (ZN A6-2), MASK AS REQUIRED
TO APPLY PRIME AND APPLY CLEAR COAT ONLY
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 27.7 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1 CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS 50 TO 70 DEGREES FROM BOTTOM OF CROSSTUBE OPPOSITE D2894-1 SUPPORT.
- TORQUE CLAMPS 80 TO 100 IN-LB. TORQUE CLAMPS ON D3190-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.


RELEASED

2015 APR 09


47 ECN 15-557

G	INCORP. DEO's D407-667-245-F1/F2 (ZN D8-1, A8-1, D5-2, B6-2, C6-2); 8.90 WAS 8.53 (ZN D5-2); TORQUE REDUCED FOR CHAFING SHIELD (ZN A8-1); FINISH REVISED TO ALLOW MANUFAC. FLEXIBILITY (ZN C8-1)	RF	15.03.20
F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECN#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -B51 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	47	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	47	DRAWING NO.	REV. G
MFG. APPR.	47	D407-667-245	SHEET 1 OF 4
APPROVED	47	TITLE	SCALE
DE APPR.	47	CROSSTUBE ASSY (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE COPIED FOR ANY PURPOSE OR COPIES OR CONTAINED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


SUPPLY
133036 MW
15-05 25

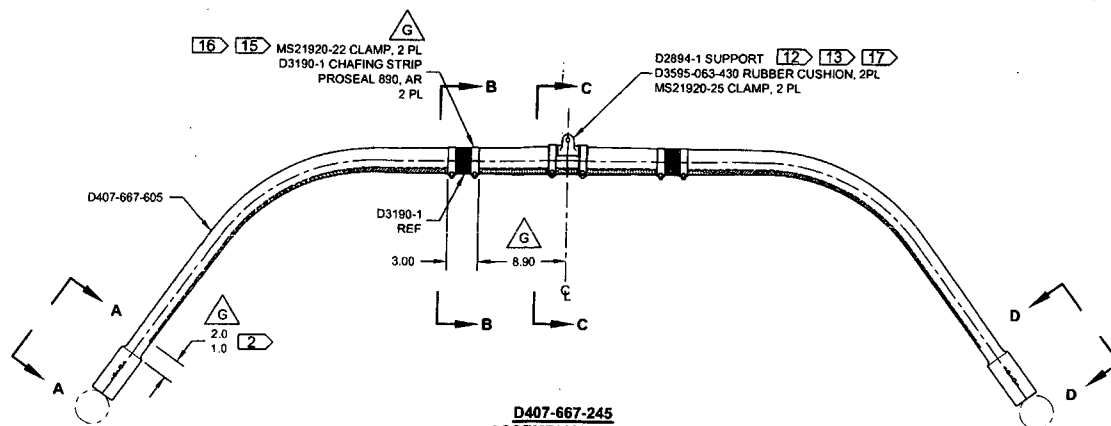


**D407-667-245
ASSEMBLY DETAIL
(VIEW LOOKING FWD)**

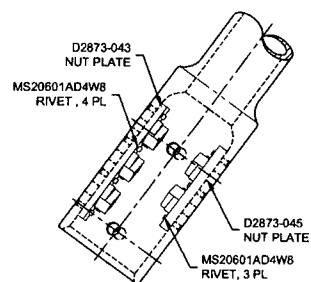


**VIEW A-A CUFF DETAIL
SCALE 4X**

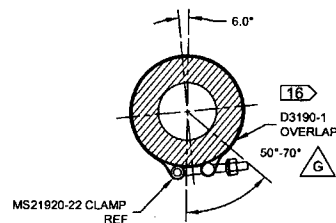


**SECTION B-B
SCALE 4X, 2PL**

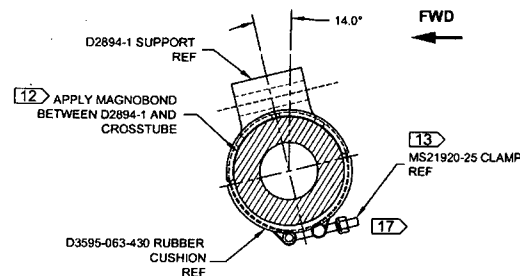

**SECTION C-C
SCALE 4X**

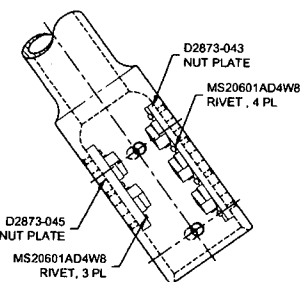


**VIEW D-D CUFF DETAIL
SCALE 4X**

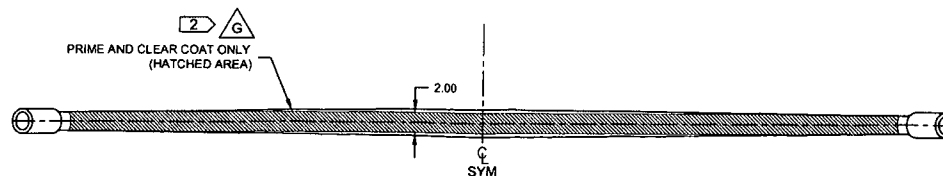


RELEASED
2015 APR 08 *ap*

DESIGN	<i>ap</i>	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>ap</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>ap</i>	D407-667-245	SHEET 2 OF 4
APPROVED	<i>ap</i>	TITLE	SCALE
DE APPR.	<i>ap</i>	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	


8 7 6 5 4 3 2 1

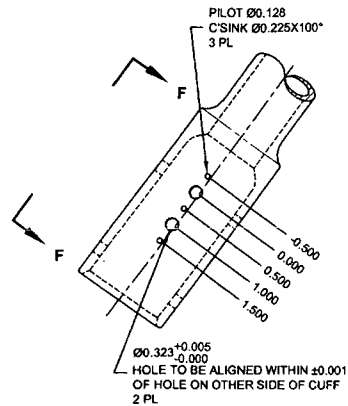


DETAIL E
SCALE 4X
(VIEW LOOKING FWD)

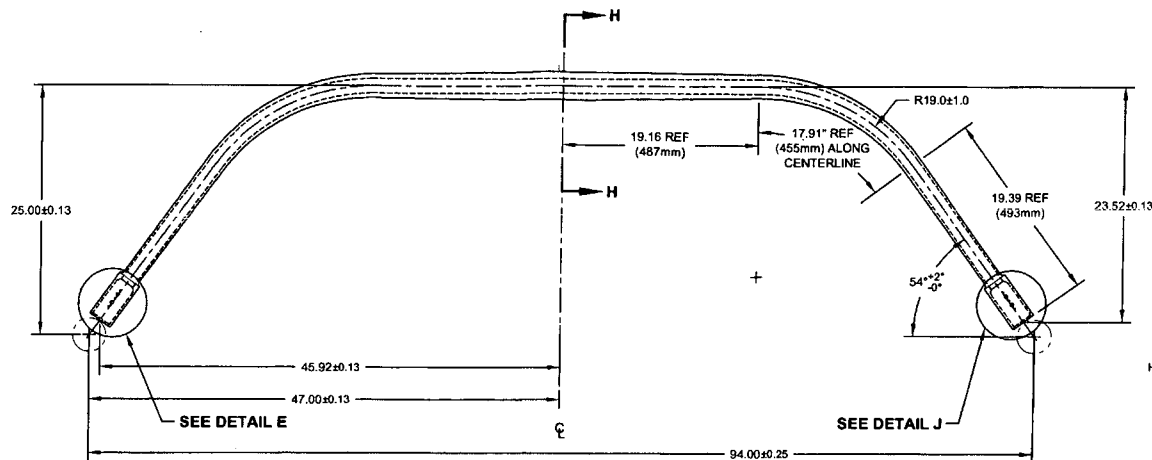


D407-667-605
BENDING AND DRILLING DETAIL
(VIEW LOOKING FWD)

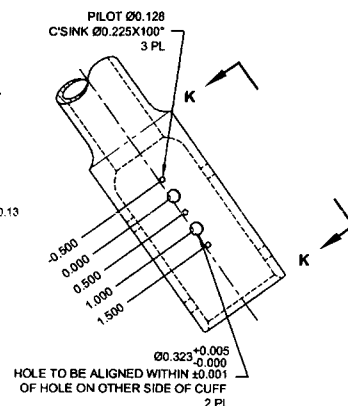


DETAIL J
SCALE 4X
(VIEW LOOKING FWD)

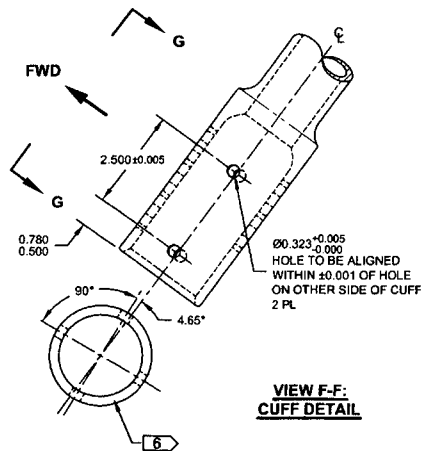


VIEW F-F:
CUFF DETAIL

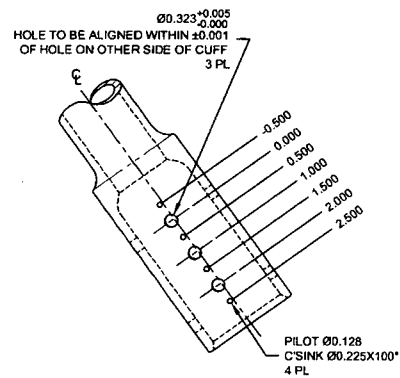


VIEW G-G
(VIEW LOOKING AFT, ROTATED)

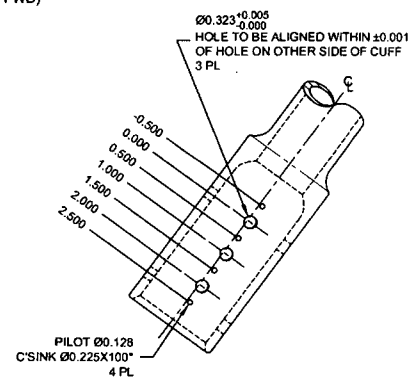

VIEW L-L
(VIEW LOOKING AFT, ROTATED)

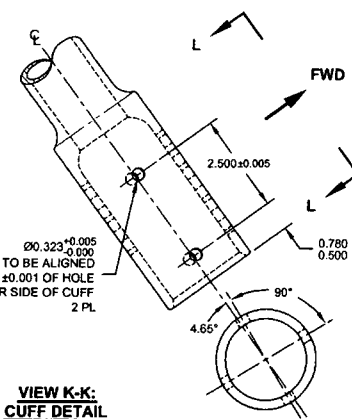

VIEW K-K:
CUFF DETAIL

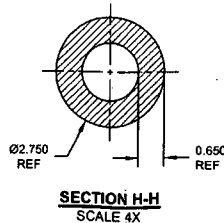


SECTION H-H
SCALE 4X

RELEASED

2015 APR 09

DESIGN	Q	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. G
MFG. APPR.	Q	D407-667-245	SHEET 3 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

8 7 6 5 4 3 2 1

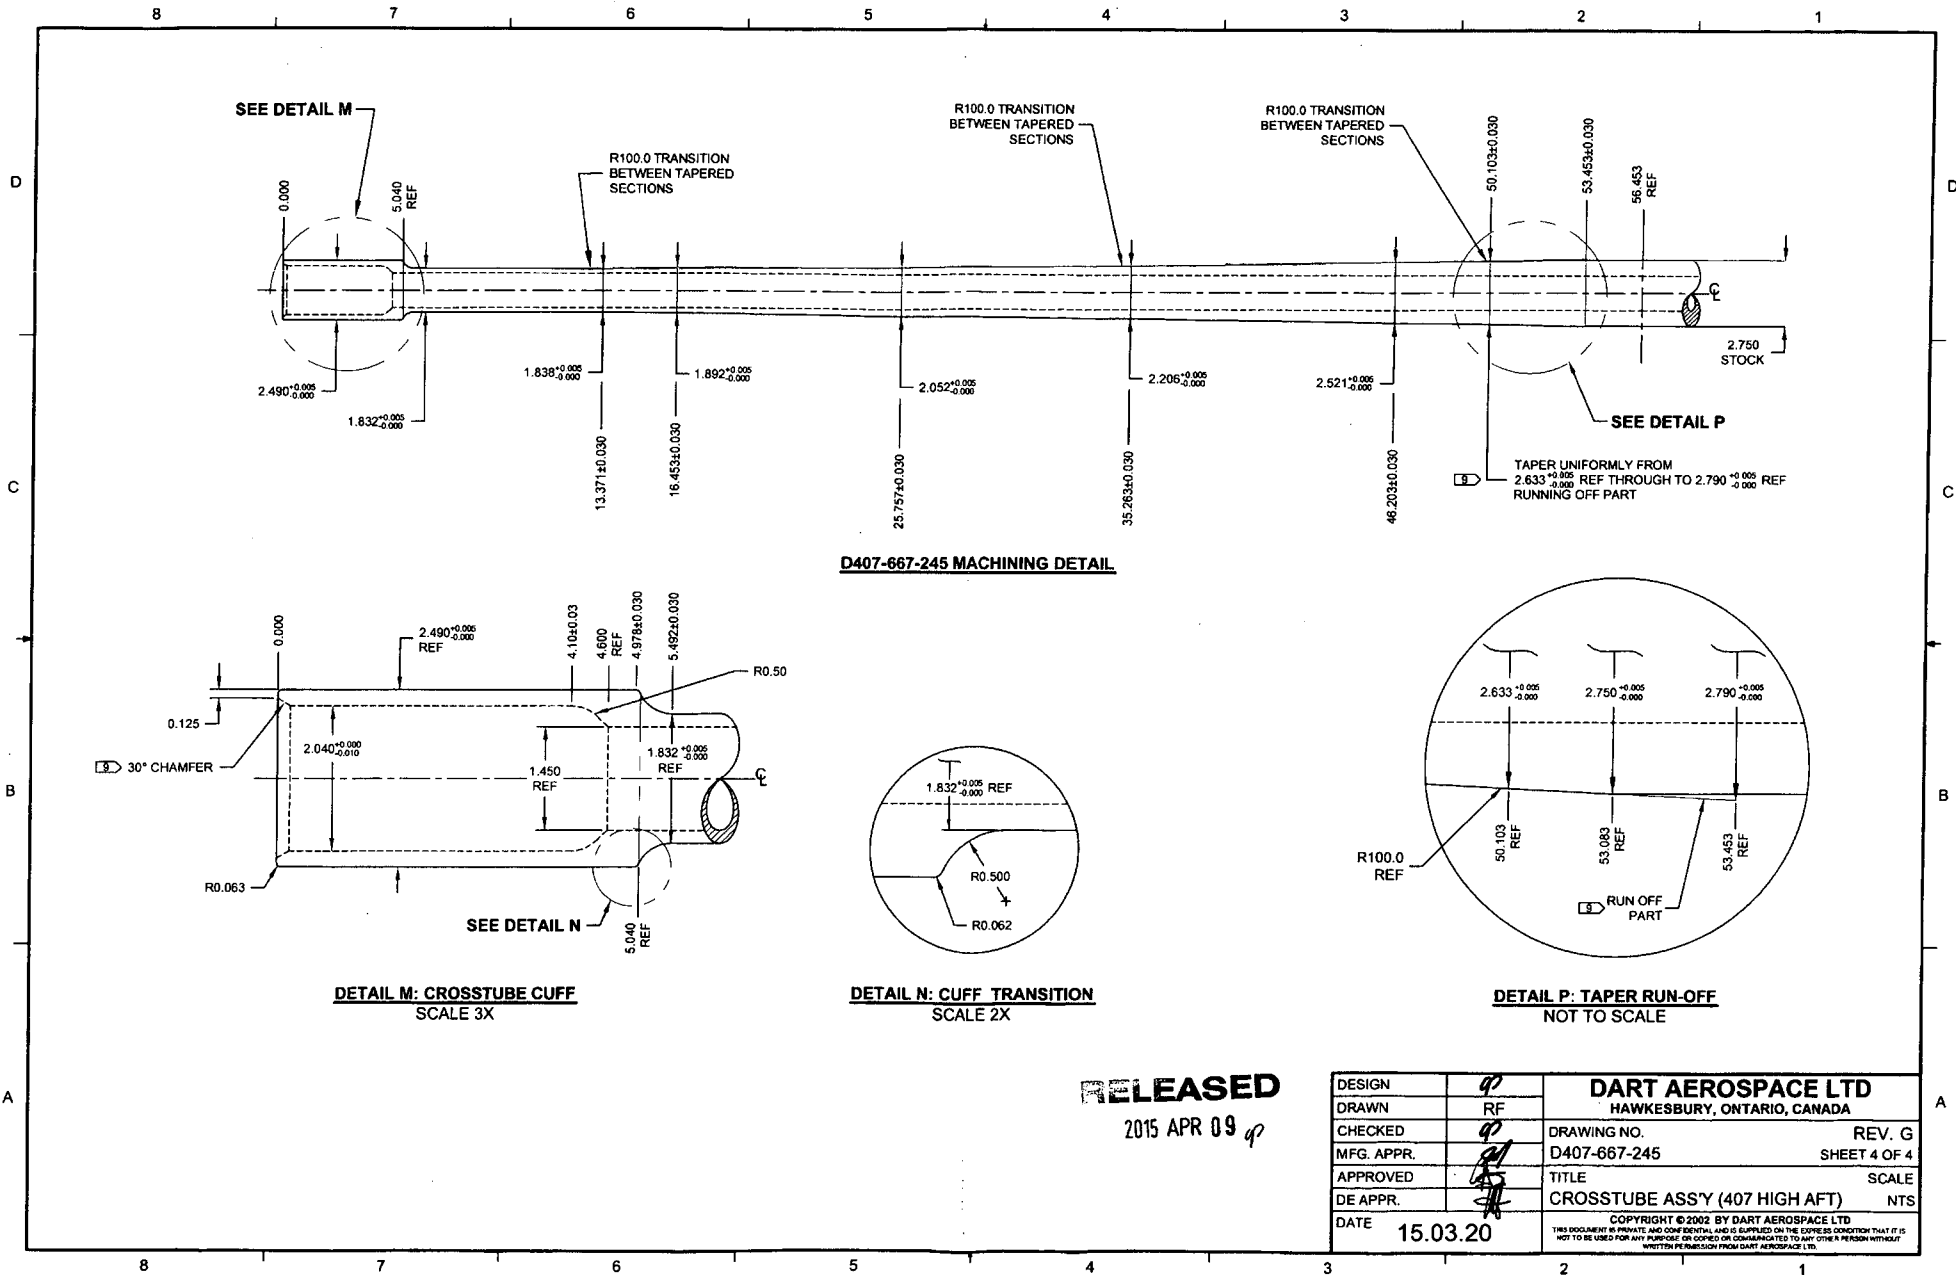

D407-667-245 MACHINING DETAIL

DETAIL M: CROSSTUBE CUFF
SCALE 3X

DETAIL N: CUFF TRANSITION
SCALE 2X

DETAIL P: TAPER RUN-OFF
NOT TO SCALE

RELEASED
2015 APR 09

DESIGN	47	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	47	DRAWING NO.	REV. G
MFG. APPR.	47	D407-667-245	SHEET 4 OF 4
APPROVED	47	TITLE	SCALE
DE APPR.	47	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	